


# **METHOD STATEMENT FOR THE INSTALLATION OF REDIWELD REDIPAVE 500mm SPLITTER ISLANDS**

<b>PROJECT INFORMATION</b>	
<b>Company Details:</b>	<p>Rediweld Rubber &amp; Plastics Limited 6/9 Newman Lane ALTON Hampshire GU34 2QR Tel: 01420 543007 Fax: 01420 544090 E-Mail: <a href="mailto:info@rediweld.co.uk">info@rediweld.co.uk</a></p>  <p><b>REDIWELD</b></p>
<b>Site Address:</b>	
<b>Activity-Risk:</b>	To install rubber Splitter Islands.



## IMPLEMENTATION & CONTROL OF RISK

Hazardous Task – Risk	Method of Control
<p>1. Put out warning signs and sufficient traffic management measures to ensure the safety of operatives, road users and pedestrians. Risk to operatives and third parties will be high.</p>	<p>Operatives will follow the correct procedure for accessing the site. Works vehicles will be safely positioned with amber beacons on. Warning signs and traffic management measures will be positioned, as per Chapter 8. The site will be clearly defined and barriered. Safety zones will be maintained at all times. Signs will be adequately placed and sandbagged if necessary. If two-way lights are to be used, cables will be run along edges and channel strips will be used. A safe, signed pedestrian route will be provided and maintained at all times. Reversing operations will be minimised.</p> <p>Operatives will have adequate training in manual handling and will employ manual handling techniques to lift individual rubber units at all times. Operatives will wear gloves and safety boots, at all times to prevent trapped fingers and damaged feet. A first aid box will be provided on site at all times. Operatives will only work within the site ‘working space’ to protect both third parties.</p> <p>Plans of services will be obtained prior to commencing work on site. A visual survey of the area and a ‘CAT’ scan will be carried out prior to drilling. Operatives will wear appropriate eye, ear and feet protection. Dust masks will be worn, if necessary. Regular checks will be made on the condition of airlines and the tightness of fittings. Hoses will be run safely and will avoid pedestrian routes. To prevent vibration white finger, reduced vibration equipment will be used, regular job rotation will be implemented and operative’s hands will be kept as warm as possible. Fuel for generators will</p>
<p>2. Mark road were RediPave Splitter Islands are to be positioned, and assemble Redipave modules accordingly. Risk to operatives will be medium. Risk to third parties will be low.</p>	
<p>3. Loose lay Redipave Splitter modules, Ensure all modules are butted tightly together. With a 14mm drill bit, commence drilling through holes to a depth of 270mm from the module surface into the carriageway, The drill used will be a Hilti T15 or T21 hammer drill (<i>or similar</i>) attached to a 3 kva generator via a 25 m. 110 v extension lead. Risk to operatives will be medium. Risk to third parties will be low.</p>	
<p>4. Blow out fixing holes using a long nosed air gun, powered by a 120psi portable compressor, insert resin commencing at base of hole, 2 to 3 pumps are required using a resin gun supplied by Rediweld Risk to operatives will be medium. Risk to third parties will be low.</p>	

<p>5. Insert countersunk torx-screw through black plastic anchor block and attach Rediplug and tap down assembly to surface level and tighten with impact wrench, ensuring torx-screw is firmly seated Risk to operatives will be low. Risk to third parties will be low.</p>	<p>be stored in suitable containers in a secure area. Caps will be kept on fuel containers and refuelling will not take place near storm drains or watercourses. Spill kits and a fire extinguisher will be available on site at all times. (Refer to COSHH sheets for petrol).</p>
<p>6. Repeat drilling, blowing, and resin for the remaining middle and outer holes using the black plastic anchor fixing to secure centre sections and the Coachscrew, Black Washer and Rediplug for the outer sides of the Splitter Islands. Drill the remaining outside holes, blow out holes and resin. <b>Warning – resin will harden within 25 minutes.</b> Risks - as outlined earlier.</p>	<p>Operatives will wear appropriate P.P.E – gloves, goggles, masks and long sleeves. Operatives will only use the air gun within the site ‘working space’ to protect third parties. Resin containers will be stored in a secure area, with caps on to prevent spillage / water contamination. (Refer to COSHH sheets for resin). Safety measures relating to the generator, portable compressor and hoses will apply as outlined in section 3.</p>
<p>8. Remove all work debris &amp; personal rubbish from site. Risk to operatives will be medium. Risk to third parties will be low.</p>	<p>As outlined earlier.</p>
<p>9. Remove traffic management signs and barriers. Risk to operatives and third parties will be high.</p>	<p>As outlined earlier.</p> <p>Operatives will have good hygiene standards, use gloves (where practical), clean and cover cuts and will carry a Leptospirosis card.</p> <p>Operatives will comply with the sequence of removing signs as per Chapter 8 when dismantling traffic management measures.</p>